

SECRET

12 AUG 69 14 18Z

S E C R E T 12135Z AUG 69 CITE [] 5800

021-68169 25X1
25X1

SUBJECT: EVALUATION OF OLD HEAD MISSION G-094

1. IMAGE QUALITY: THE OVERALL QUALITY OF THIS MISSION IS GOOD. A SLIGHT IMPROVEMENT IN THE IMAGE QUALITY IS APPARENT FROM THE BEGINNING OF THE MISSION TO THE END. INTERPRETATION SUITABILITY IS FAIR; WEATHER IS THE MAJOR DEGRADING FACTOR. CLOUD COVER AND HAZE OBSCURE 25 PERCENT OF THE ENTIRE MISSION.

2. MISSION DATA:

- A. G-094
- B. 9 AUGUST 1969
- C. B/24/U2R
- D. MODE 5
- E. T/O 1055Z, C/ON 1307Z
- F. 3401
- G. 1/400
- H. F/11
- I. MINUS BLUE (WRITTEN 12)
- J. NAV RECON TECH SUPPCEN, MX578
- K. LEFT SIDE: 2.14; RIGHT SIDE: 2.11

DISTRIBUTION		
CY	OFFICE	PI
1	FILE	
2	CABLE SEC.	
	PP&B/ED	
	SECUR.	
3,4	TSSG/ASD	✓
	PSG/OC	
	RRD	
	REPRO	
	AID	
	IDG	
	PROD	25X1
	SCIEN	
	WEST	
	EAST	
	M&S	
	PCM	
	IAS	
	DIA-XX4	
	SPAD	
	DIA-AP	
	CMX	25X1

PAGE 2 [] 6800 S E C R E T

3. ORIGINAL NEGATIVE:

A. EXPOSURE: SLIGHTLY UNDEREXPOSED IN THE BEGINNING OF THE MISSION TO SLIGHTLY OVEREXPOSED AT THE END OF THE MISSION.

B. DENSITY AND CONTRAST: GENERALLY MEDIUM THROUGHOUT THE MISSION.

C. IMAGED DEGRADATIONS:

- (1) RIGHT SIDE: SEE (3) BOTH SIDES.
- (2) LEFT SIDE: SEE (3) BOTH SIDES.
- (3) BOTH SIDES: EDGE FOG IS PRESENT INTERMITTENTLY ALONG BOTH EDGES THROUGHOUT THE MISSION. MINOR ROLLER CHATTER IS PRESENT ALONG THE INBOARD EDGE.

D. PHYSICAL DEGRADATIONS:

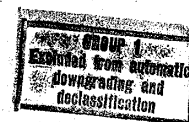
- (1) RIGHT SIDE: FOUR HEAT SPLICES AND TWO MANUFACTURER'S SPLICES ARE PRESENT IN THE MISSION MATERIAL.
- (2) LEFT SIDE: ONE HEAT SPLICE AND ONE MANUFACTURER'S SPLICE ARE PRESENT IN THE MISSION MATERIAL.

E. AUXILIARY DATA: THE VERTICAL INDICATOR LIGHT SOURCE IS ALMOST COMPLETELY OBSCURED ON THE LEFT SIDE AND

ADVANCE CY
SANITIZED
WITH TEXT

PAGE 3 [] 6800 S E C R E T
PARTIALLY OBSCURED ON THE RIGHT SIDE. ALL OTHER DATA RECORDING EQUIPMENT FUNCTIONED PROPERLY.

F. THE LAST TITLED FRAME IS 1609 FOR EACH SIDE.

SECRET

4. POSITIVES: PRINTING AND PROCESSING ARE ADEQUATE FOR INTERPRETATION PURPOSES.

5. REMARKS: THE 9L SIDE VERTICAL INDICATOR LIGHT SOURCE HAS BEEN ALMOST COMPLETELY OBSCURED ON THE PAST SIX MISSIONS EMPLOYING THIS CAMERA.

S E C R E T

--END OF MESSAGE--